



STEP 1

Flux end of cable, Stick cable into solder pot to dimensions shown, for 3 seconds maximum.

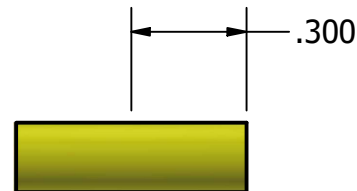


STEP 2

Trim cable to dimensions shown. Point center conductor.

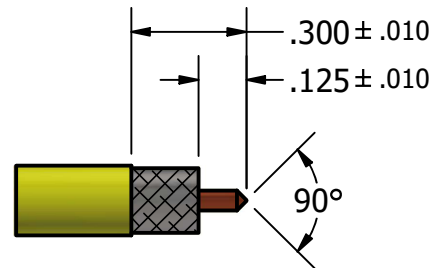

STEP 3

Slide connector onto cable until cable bottoms in body. Solder body to cable braid thru side hole/ Clean solder joint.

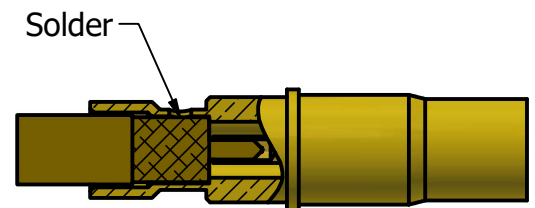

WARNING - THIS DOCUMENT CONTAINS TECHNICAL DATA WHOSE EXPORT IS RESTRICTED BY THE ARMS EXPORT CONTROL ACT (TITLE 22, U.S.C., SEC 2751, ET. SEQ.) OR THE EXPORT ADMINISTRATION ACT OF 1979, AS AMENDED, TITLE 50, U.S.C., APP 2401 ET SEQ. VIOLATIONS OF THESE EXPORT LAWS ARE SUBJECT TO SEVERE CRIMINAL PENALTIES. DISSEMINATE IN ACCORDANCE WITH PROVISIONS OF DOD DIRECTIVE 5230.25.

The information and designs disclosed in this document are confidential and/or proprietary to The Phoenix Company of Chicago, Inc. and may not be used for manufacturing, reproduced, disclosed to others, or used for any other purpose without express written consent of The Phoenix Company of Chicago, Inc.

MATERIAL:

REV.	DESCRIPTION	BY	DATE	APPR.	DATE
G	PER ECN 14600	EWM	3/30/2026	DRW	8/31/2026
F	PER ECN 14232	BAK	10/14/2024	DW	11/26/2024
E	PER ECN 13529			JEM	10/14/2019
D	PER ECN 12755			JEM	1/3/2018
C	PER ECN 9684			JEM	12/8/2008
B	PER ECN 5487			HN	6/6/2000

UNLESS OTHERWISE SPECIFIED, PHOENIX WORKMANSHIP STANDARDS APPLY DIMENSIONS IN INCHES OR [METRIC]	
DO NOT SCALE PRINTS	
TOLERANCES ARE: FRACTIONS: $\pm 1/64$ DECIMALS: $.XX \pm .01$ $.XXX \pm .003$ ANGLES: $\pm 1/2^\circ$	

APPROVALS	DATE
DRAWN JEM	5/18/2000
CHECKED QA	
MFG	
ENGINEER	
APPROVED HN	5/18/2000

The **PHOENIX** Company of Chicago, Inc.

22 GREAT HILL RD., NAUGATUCK, CT 06770
WWW.PHOENIXOFCHICAGO.COM
PHONE: (800) 323-9562 FAX: (630) 206-1801

CABLE ASSEMBLY PROCEDURE FOR 78-1020-1481

SIZE	FSCM	DWG NO	REV	PLATING OPT.
A	58167	78-1020-1481	G	
SCALE	2:1	F.S.R. #	SHEET 1	OF 1